



GLOBAL LASER

It has come to our attention recently that a number of Brother machines need to be “reset” when a new remanufactured (and periodically OEM) toner gets put in.

7440 Series (toner TN360 series) works for the MFC8460n (TN580)

Open door

press Clear/Back key (or options key)

*press *00*

press OK

Do not choose anything for drum replacement. When drum replacement menu comes up, just press the * and then 00, then just press OK.

HL2040 series (toner TN350 series)

- Brother ML-2040 Toner Light Reset

When replacing the toner cartridge in the Brother HL-2040 with a new cartridge (compatible or remanufactured) the user may experience a problem with the toner light staying on, even with the new toner installed. The procedure below has worked for many folks, so give it a shot.

Open the front cover of the Brother HL-2040 and leave open while completing the following steps:

- 1.) Turn the printer off.*
 - 2.) Hold the ‘go’ button while turning the printer on. All panel lights should be on.*
 - 3.) Release the ‘go’ button once all lights are off.*
 - 4.) Press the ‘go’ button 2 times.*
 - 5.) Pause.*
 - 6.) Press the ‘go’ button 5 times.*
 - 7.) The toner light should be off.*
 - 8.) The paper light should be on.*
 - 9.) Close cover. The ready light should be the only light on.*
- Once all steps are successfully completed your “low toner” light should be fixed.*

MFC-7220 / 2820 Series (toner TN350 series)

1.) open front cover

2.) push "options"

3.) push start

4.) push 10

Then it should read "accepted", close cover